

User:
Vehicle : 307 /307 CAN
VIN: VF33BRFJF84454510

Print date : Thursday, January 15, 2015 20:01:10

Start of vehicle session :

Tool version : 07.44




Global test

Expert /Global test

Vehicle \menu_tg_t6.s : 29_02

Family no.

Control unit

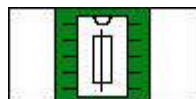

Built-in Systems Interface (BSI)

BSI (2 Faults)

C4C0 Fault: illumination of the rear RH side lamp

Properties

From .

Local .

Characterisation of the fault. Open circuit

C4C1 Fault: illumination of the rear LH side lamp

Properties

From .

Local .

Characterisation of the fault. Open circuit



Injection/ignition

MM6LPB (3 Faults)

P1644 Vehicle speed limiter switch

Properties

From .

Local .

Status .

Permanent fault

Characterisation of the fault. Short circuit to positive

List of associated variables

Engine speed	0	rpm
Engine coolant temperature	84	°C
Vehicle speed	255	Kph
Manifold pressure	950	mbars
Status of the mixture regulation	Open loop (conditions for switching to a closed loop not yet satisfied)	

P0597 Thermostat controlled

Properties	
From .	Local .
Status .	Permanent fault
Characterisation of the fault.	Open circuit

U0415 Dialogue with the ABS or the ESP


Properties	
From .	Distant .
Status .	Intermittent .
Characterisation of the fault.	Incorrect value received

List of associated variables		
Engine speed	699	rpm
Engine coolant temperature	95	°C
Vehicle speed	255	Kph
Manifold pressure	370	mbars
Status of the mixture regulation	Closed loop	




ABS/traction control

ESP8_BOSCH

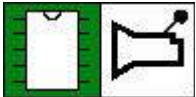


gearbox

BVA_AL4_AT8

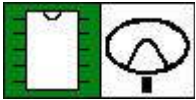


Power steering electric pump unit

GEP

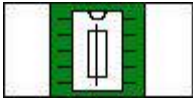

Engine relay unit

BSM

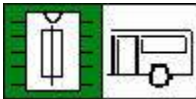

Trailer relay unit

★ BSR
Important, ECU present on the vehicle but configured absent




Driver and passenger airbags

SAC_AUTOLIV



Instrument panel

COMBINE

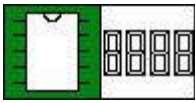


Multifunction display

EMF_C (1 Faults)

F8EB Fault: absence of the screen permanent plus

Properties	
From .	Local .
Characterisation of the fault.	Not characterised.

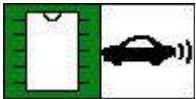


Parking aid

AAS




Switch module under the steering wheel (top of column)

HDC

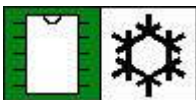

heating/ventilation

CLIM_REGULEE

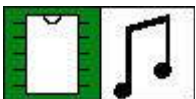


Radio or radiotelephone (radio part)

AUTORADIO (1 Faults)

F905 Fault on auxiliary audio input n° 1.

Properties	
From .	Local .
Characterisation of the fault.	Not characterised.

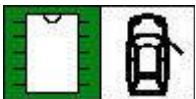

Passenger door electronics

EDPP (1 Faults)


FC02 Mirror mechanism sensors input fault .

Properties	
From .	Local .
Characterisation of the fault.	Not characterised.



Driver's door electronics

EDPC

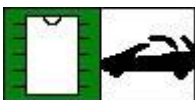

Folding roof

BTE




Rain and brightness sensor

PLUIE_LUMINOSITE



High frequency receiver

Communication error

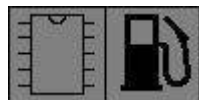


Diesel additive

Not present



Diesel additive adding pump

Not present

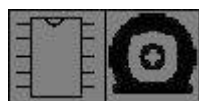

Under inflation detection

Not present




Right headlamp beam corrector *1

Not present



Left headlamp beam level corrector *1

Not present

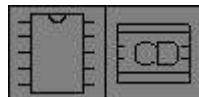

CD player

Not present




Hands-free kit (Telephone)

Not present




Telematics

Not present

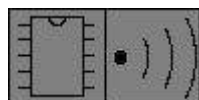

Anti-theft alarm

Not present

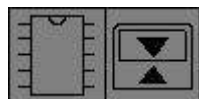


Sun roof

Not present



Driving school module

Not present

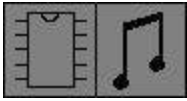

Services module

Not present

Help