REMOVAL - REFITTING : FASCIA STORAGE COMPARTMENT :

1. Recommended tools

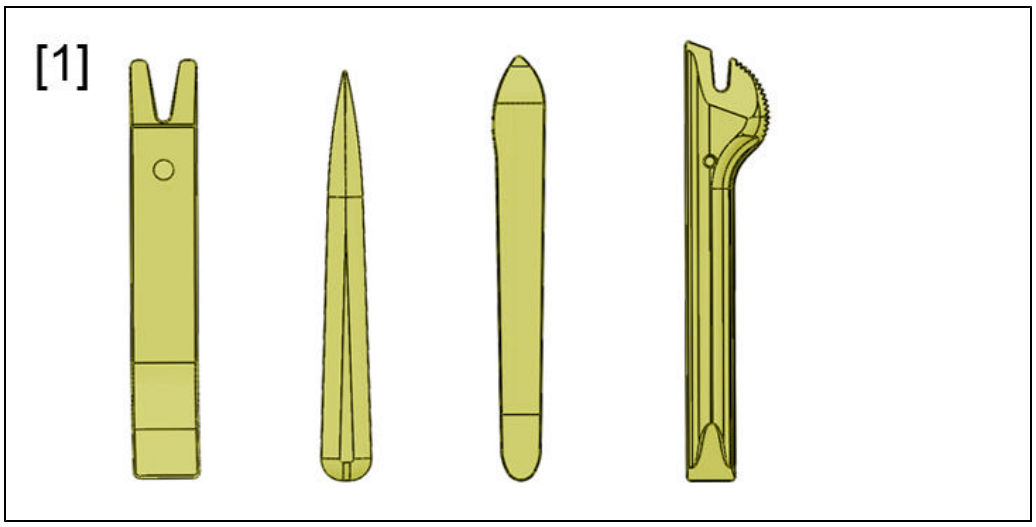


Figure : E5AP30WD

[1] Trim removal tools (-).1350-ZZ .

2. Preliminary operations

Perform the following operations :

- Take out the ignition key
- Wait at least 10 minutes before disconnecting the battery
- Disconnect the battery negative terminal

3. Removal

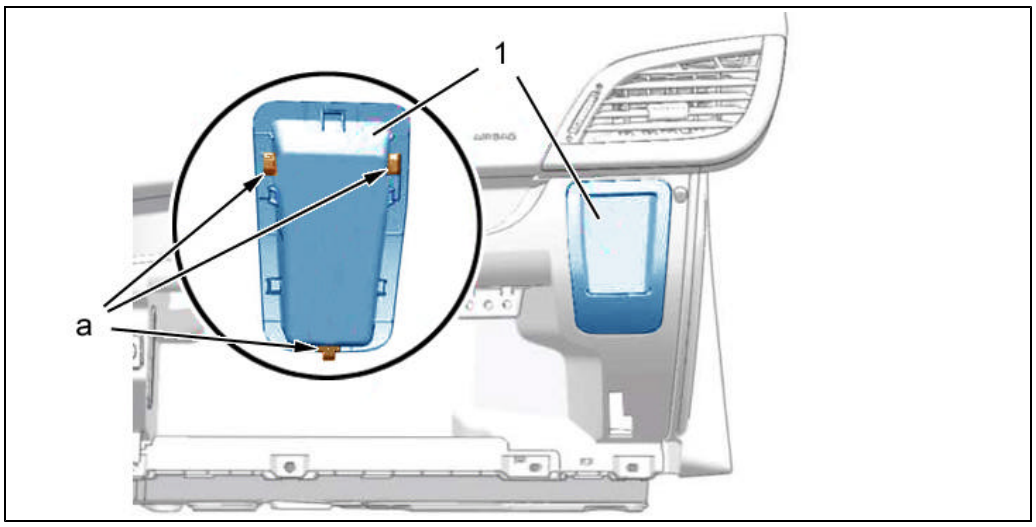


Figure : C5FP1CPD

Open the glove-box .
Unclip the cover (1) ; Using the tool [1] (At "a") .
Remove the cover (1) .

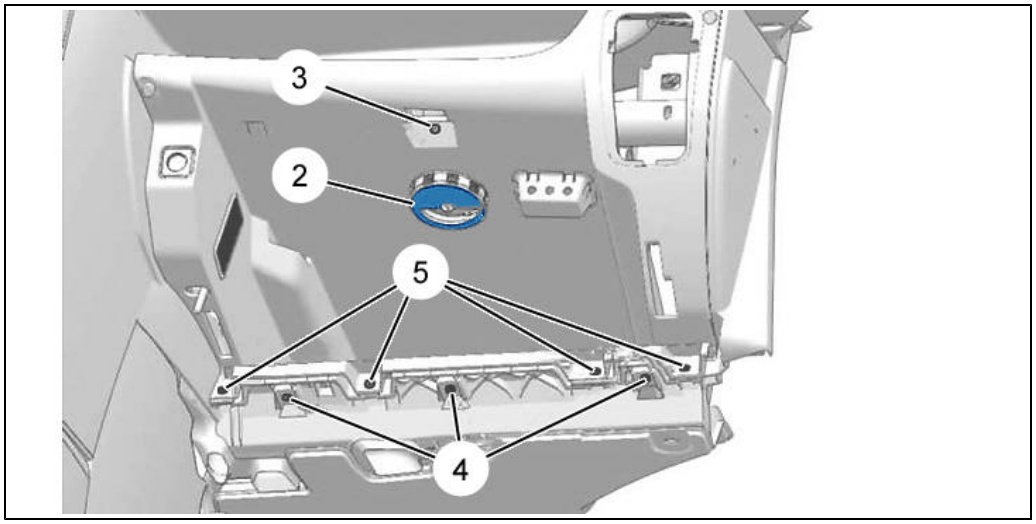


Figure : C5FP1CQD

Unclip and remove the control knob (2) (According to specification) .
Remove the bolts (3), (4) .
Detach the lower part of the storage compartment .
Remove the bolts (5) .

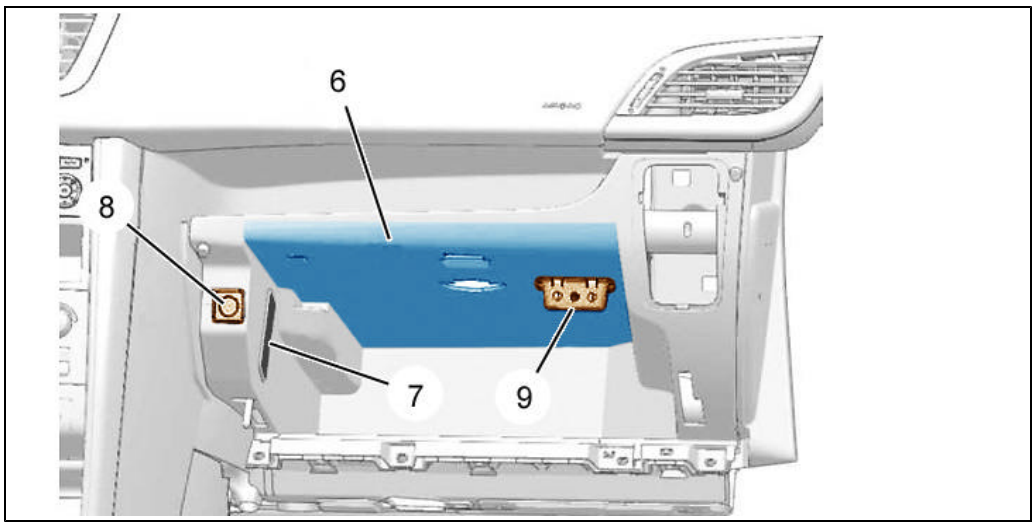


Figure : C5FP1CRD

Detach the storage compartment assembly (6) towards the outside .
Disconnect :

- The glove box light connector (7)
- The passenger air bag control connector (8)

Unclip and remove :

- The storage compartment light (7)
- The passenger air bag control (8)
- The audio/video peripheral socket (9) (According to specification)

Remove the storage compartment assembly (6) .

4. Refitting

Proceed in the reverse order to removal .

CAUTION : Perform the operations to be carried out following reconnection of the battery .

Connect the battery .

N.B. : If a fault code appears at the air bag warning light , the fault code can be cleared ; Using the diagnostic tool .

Check the operation of the electrical equipment .